

Figure 6 – Photos exhibiting typical conditions along recently constructed hiking trail: 6.1) Trail Through Mature Forest, 6.2) Side-hill Trail Construction, 6.3) Treadway Stabilized by Mosses and Outsloping, and 6.4) Recently Constructed Trail Segment Stabilized by Vegetation.

Figure 6.1 -- Trail Through Mature Forest.



Figure 6.2 -- Side-hill Trail Construction.



Figure 6 – Photos exhibiting typical conditions along recently constructed hiking trail: 6.1) Trail Through Mature Forest, 6.2) Side-hill Trail Construction, 6.3) Treadway Stabilized by Mosses and Outsloping, and 6.4) Recently Constructed Trail Segment Stabilized by Vegetation.

Figure 6.3 -- Treadway Stabilized by Mosses and Outsloping.



Figure 6.4 -- Recently Constructed Trail Segment Stabilized by Vegetation.

